

YOSHIMURA

RESEARCH&DEVELOPMENT OF AMERICA, INC.


5420 DANIELS STREET STE A, CHINO CA., 91786 · (800)634-9166 · (909)628-4722 · FACSIMILE (909)591-2198

www.yoshimura-rd.com

RS-3 OVAL PERFORMANCE EXHAUST SYSTEM


SUZUKI '97-01 TL10005

TL10850C	RS-3 ZYCLONE BOLT-ON SYSTEM
TL10950	RS-3 RACE BOLT-ON SYSTEM

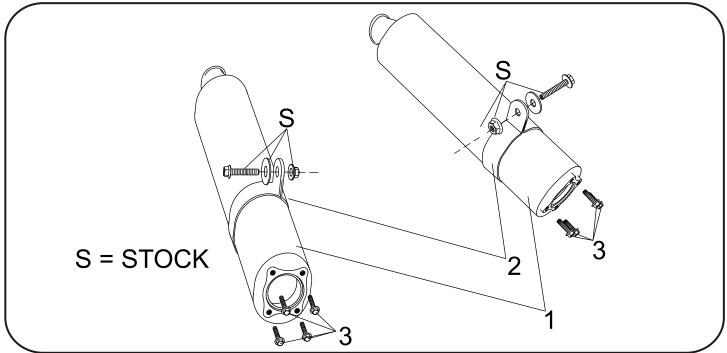

Parts Diagram

NO.	DESCRIPTION	QTY	PART#
1	Oval Muffler Assembly	2	**
2	Stainless Steel Muffler Clamp		
	Stainless Steel or Titanium Sleeve uses		COS450S8ASX
	Carbon Fiber Sleeve uses		COS450S8AS
3	8mm X 20mm Hex Head Bolts	8	M8X20H
**	Muffler Clamp Heat Insulator	2	HT SHLDTRS
**	Instructions	1	INST KIT
**	Yoshimura Sticker	1	17029

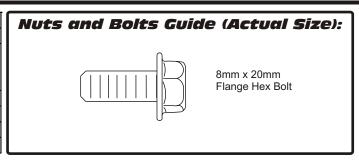



THIS PRODUCT IS DESIGNED FOR USE IN CLOSED COURSE RACING AND IS NOT INTENDED FOR HIGHWAY USE.



NOTE: IN THE STATE OF CALIFORNIA, IT IS ILLEGAL TO MODIFY THE EMISSION CONTROL SYSTEM. WHICH INCLUDES THE CARBURETORS OF ANY VEHICLE.

Caution: Exhaust system can be extremely hot. Let motorcycle cool down before beginning installation.

Note: Read through all instructions before beginning installation.


Tools Needed:

12mm socket 3/8" ratchet 12mm and 14mm wrenches Torque wrench


Installation Steps:

- 1 Remove stock mufflers and muffler gaskets.
- 2 Install new muffler gaskets. (Not supplied - Suzuki part no. 14181-02F00)
- 3 Install Yoshimura mufflers using supplied bolts. Torque bolts to 2.3 kg-m (16.5 lb-ft).
- 4 Apply muffler clamp heat insulator to inside of muffler clamps and slide clamps onto mufflers. (note direction of clamps in Fig. 1&2)
- 5 Mount clamps to stock muffler brackets using stock bolts, washers, and nuts. (see Fig. 1&2)
 Torque bolt to 2.5 kg-m (18 lb-ft).
- 6 Check for proper clearance between new muffler and motorcycle. (i.e. swing-arm, passenger foot-peg, rear wheel, etc.) If any problem is found, please carefully follow through the installation steps again. If problem still persists, please call Yoshimura tech. Dept. at (800)634-9166 / in CA (909)628-4722

Note: After starting motorcycle, it is normal for new exhaust system to smoke until oil residue burns off.

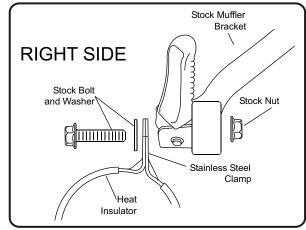

Right Side Fig.1

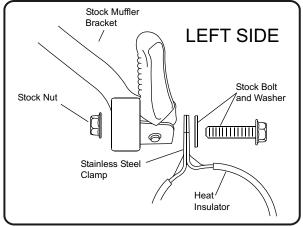

Left Side

Fig. 2