

RACE SERIES

Qualified Manufacturer Declared "Modified Part"


APPLICATION		
YEAR	MODEL	
2007-2016 Suzuki V-Strom 650		
PRODUCT		
1162040220	2040220 R77 SS 3/4 System with Carbon Fiber Sleeve; Carbon Fiber Endcap	
1162040520 R77 SS 3/4 System with Stainless Steel Sleeve; Carbon Fiber Endcap		

FOR CLOSED COURSE COMPETITION ONLY; NOT INTENDED FOR STREET USE




This product is designed for use in closed course racing and is not intended for highway use.

In the state of California, it is illegal to modify the emission control system, which includes the fuel injection of any vehicle.





Read through all instructions before beginning installation. Exhaust system can be extremely hot. Let motorcycle cool down before beginning installation. Always wear hand and eye protection and take precautionary measures to avoid injury.

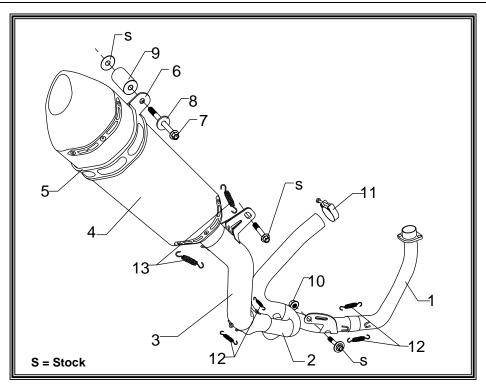

No.	Part #	Description	Qty
1	11620-401	Yoshimura Header	1
2	11620-415	Yoshimura Midpipe	1
3	11620-419	Yoshimura Tailpipe	1
4		Yoshimura Muffler	1
	1162040220-RMA 1162040520-RMA	Carbon Fiber Sleeve Stainless Steel Sleeve	
5	HT SHLDR77	Muffler Clamp Heatshield	1
6	1121-MPCR 1121-MPCRX	Muffler Clamp for CF Sleeve SS Sleeve	1
7	M8X90H	8mm x 90mm Flanged Hex Head Bolt	1
8	8MMWASHERL	8mm Large Washer	1
9	ALS-036	Aluminum Spacer	1
10	8MMNUT	8mm Flange Nut	1
11	22055	Exhaust Clamp	1
12	RACE-SPS-1	Medium Spring	4
13	RACE-SPX-1	Short Spring	2
**	OXYBA12X125SS	O2 Bung Adaptor	1
**	M18X13PLG	O2 Bung Plug	1
**	ST-200	Spring Puller Tool	1
**	17029	Yoshimura Sticker Sheet	1
**	INS-04-K	Low Volume Sound Insert	1

-TOOLS REQUIRED-

Metric Socket Set • Combination Wrench Set • Torque Wrench • Metric Allen Wrench Set

-REMOVAL-

- 1. Remove the right passenger foot peg.
- 2. Remove the two piece muffler heatshield.
- 3. Remove O2 sensor from stock muffler.
 - Note: '07-'11 models do not have O2 sensor.
- 4. Loosen both front and rear header exhaust clamps.
- 5. Remove chassis mount bolt.
- 6. Remove the muffler mount bolt closest to the rear of vehicle.
- 7. Loosen the muffler mount bolt closest to the front. This will allow the stock muffler assembly to swing forward just enough to aid in removal of the front header.
- 8. Remove the (2) front header bolts.
- 9. Carefully remove front header by pulling toward the front of the vehicle.
- 10. Remove the previously loosened muffler mount bolt. Carefully remove stock muffler assembly by sliding off of rear header.

-INSTALLATION-

- 1. Slide provided exhaust clamp onto rear header midpipe inlet.
- 2. Install Yoshimura midpipe by sliding onto rear header.
- 3. Slide Yoshimura front header into midpipe and install header using the stock header bolts. Note: The stock exhaust port gasket will be used with the Yoshimura 3/4 system. Inspect and replace if necessary.
- 4. Secure midpipe to chassis mount using the stock bolt. See diagram for proper orientation. Do not torque chassis mount bolt at this time.
 - Note: Secure midpipe chassis mount to the inside of the frame.
- 5. Install rubber heatshield onto Yoshimura muffler clamp.
- 6. Slide muffler clamp over Yoshimura muffler/tailpipe assembly.
- 7. Using the hardware provided in the kit, install Yoshimura muffler/tailpipe assembly as shown in the parts diagram.
 - Note: Aluminum spacer mounts on the outside of the stock muffler mount.
- 8. Install exhaust springs according to the parts diagram.
- 9. Install O2 sensor bung adaptor to Yoshimura tailpipe and install stock O2 sensor. Install the provided O2 bung plug if not equipped with an O2 sensor.
- 10. Torque muffler mount bolt to factory specification.
- 11. Torque tailpipe mount bolt to factory specification.
- 12. Torque chassis mount bolt to factory specification.
- 13. Torque stock rear header exhaust clamp to factory specification.
- 14. Torque front header bolts to factory specification.
- 15. Before starting motorcycle, check for proper clearance between new exhaust system and rear suspension (i.e. tire, swing-arm, brake, rear shock, engine, and etc.) If any problem is found, please carefully follow through the installation steps again. If problem still persists, please call Yoshimura Tech Department at (800) 634-9166 / in CA (909) 628-4722.
- 16. It is recommended that the muffler and tailpipe be wiped down with rubbing alcohol to remove oil and fingerprints. This will help prevent tarnishing of the finish after the exhaust is heated up.

 Note: After starting motorcycle, it is normal for new exhaust system and muffler to emit smoke until oil residue burns off.